


内孔车刀(螺钉式) Boring Bars(S-type)


SDQCR/L

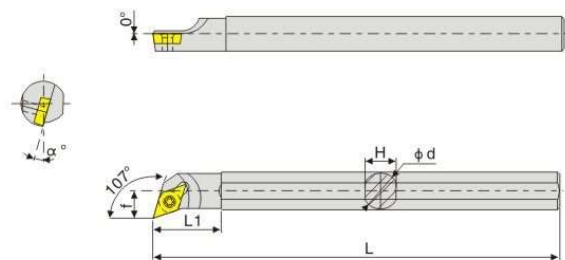

型号 Model	刀片 Insert 	适用条件 Applicable conditions							配件 Accessories	
		ϕD_{min}	ϕD	f	L	L1	H	α°	 螺丝 Screw	 扳手 Wrench
S10K-SDQCR/L07	DC□□0702□□	$\phi 13$	$\phi 10$	7	125	23	9	10°	M2.5×6	T8
S12M-SDQCR/L07		$\phi 16$	$\phi 12$	9	150	30	11	8°		
S16Q-SDQCR/L07		$\phi 20$	$\phi 16$	10.5	180	30	15	6°		
S20R-SDQCR/L11	DC□□11T3□□	$\phi 25$	$\phi 20$	13	200	39	19	6°	M4×8	T15
S25S-SDQCR/L11		$\phi 32$	$\phi 25$	16	250	40	24	4°		
S32T-SDQCR/L11		$\phi 39$	$\phi 32$	20	300	43	30	4°		
H10K-SDQCR/L07	DC□□0702□□	$\phi 13$	$\phi 10$	7	125	23	9	10°	M2.5×6	T8
H12M-SDQCR/L07		$\phi 16$	$\phi 12$	9	150	30	11	8°		
H16Q-SDQCR/L07		$\phi 20$	$\phi 16$	10.5	180	30	15	6°		

内孔车刀(螺钉式) Boring Bars(S-type)

SDZCR/L

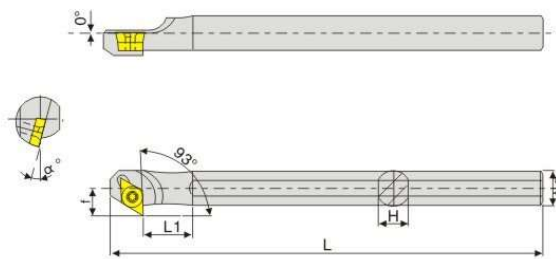

型号 Model	刀片 Insert 	适用条件 Applicable conditions							配件 Accessories	
		ϕD_{min}	ϕD	f	L	L1	H	α°	 螺丝 Screw	 扳手 Wrench
S10K-SDZCR/L07	DC□□0702□□	$\phi 16$	$\phi 10$	8.5	125	28	9	12°	M2.5×6	T8
S12M-SDZCR/L07		$\phi 18$	$\phi 12$	9.5	150	30	11	10°		
S16Q-SDZCR/L07		$\phi 24$	$\phi 16$	11.5	180	30	15	8°		
S20R-SDZCR/L11	DC□□11T3□□	$\phi 28$	$\phi 20$	14.5	200	40	19	8°	M4×10	T15
S25S-SDZCR/L11		$\phi 34$	$\phi 25$	17	250	45	24	6°		
S32T-SDZCR/L11		$\phi 38$	$\phi 32$	20.5	300	50	30	4°		